


60-100, 1070
REVISIONS

F 7019172


| NO. | REVISION | DATE | BY |
|-----|----------------------|------|----|
| 1 | WIRE P. REMOVED | | |
| 2 | WAS RELAY BOX @ LEAD | | |
| 3 | RELOCATED | | |
| 4 | MS 51302-1 ADDED | | |
| 5 | MS 51329-1 ADDED | | |

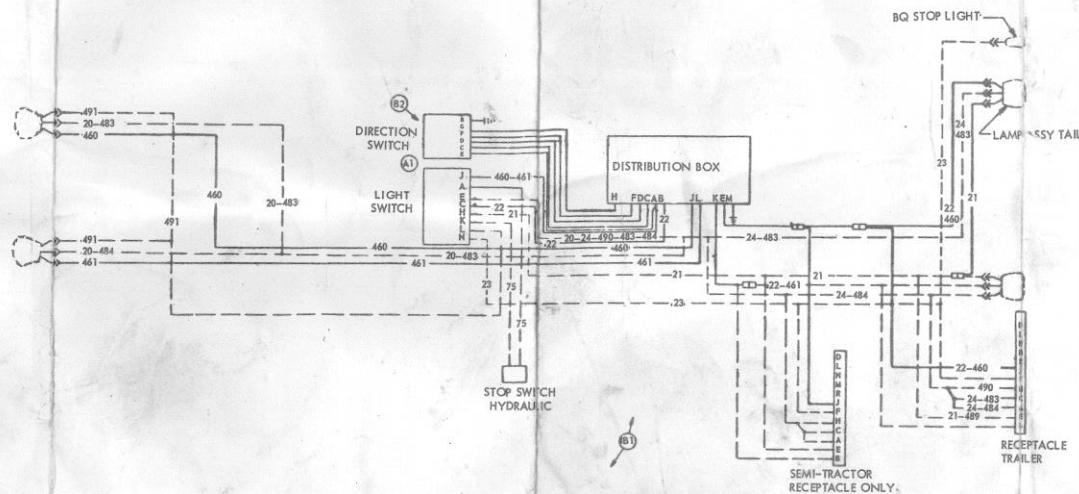

- CABLE - 7720853
(75 P. REQD 15-C-2145-170)
10 - MALE SHELL - 8338361
10 - SLEEVE - 8338562
14 - TERMINAL FEMALE CRIMPED - 8338564
9 - FEMALE SHELL - 8338566
9 - WASHER - 8338567
8 - TERMINAL SNAP - 572929
4 - "Y" CONNECTOR - 7982404
4 - SHELL - 573007
12 - INSULATOR - 573005
20 - BUSHING - 572999
4 - SHELL - 573010
4 - INSERT - 573000
4 - MALE SHELL - 573009
4 - FEMALE SHELL - 573008
4 - INSERT - 573126
4 - INSULATOR - 573002
1 - TERMINAL - 506209
4 - TERMINAL - 506205

LAMP ASSY FRONT - 8376368 (REF)
(TO BE INSTALLED IN M38 AND M38-A1)

NOTE
--- = EXISTING WIRE
--- = NEW WIRE

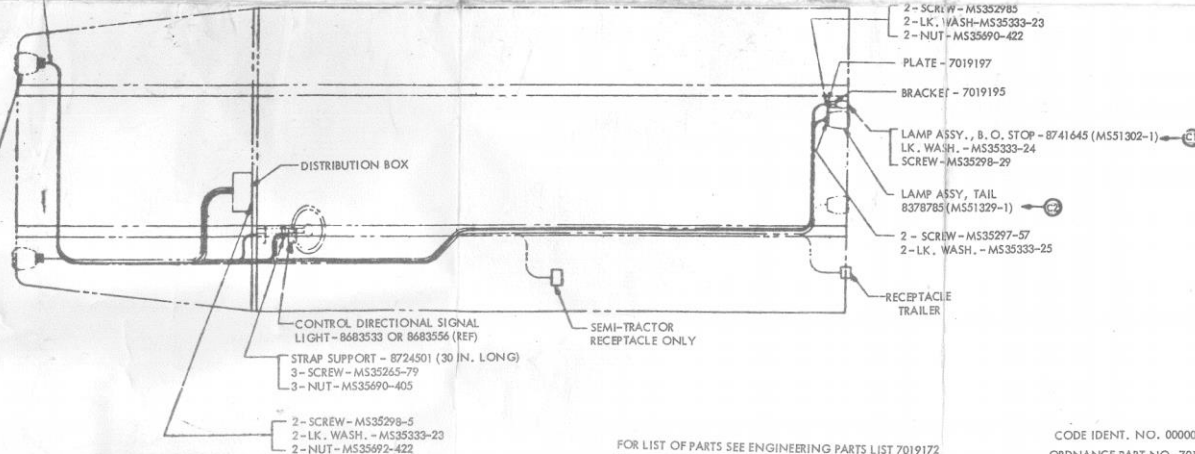

FOR LIST OF PARTS SEE ENGINEERING PARTS LIST 7019172

CODE IDENT. NO. 00000
ORDNANCE PART NO. 7019172

| | | | |
|----------|----------|----------|----------|
| REVISION | REVISION | REVISION | REVISION |
| 1 | 2 | 3 | 4 |
| 5 | 6 | 7 | 8 |
| 9 | 10 | 11 | 12 |
| 13 | 14 | 15 | 16 |
| 17 | 18 | 19 | 20 |
| 21 | 22 | 23 | 24 |
| 25 | 26 | 27 | 28 |
| 29 | 30 | 31 | 32 |
| 33 | 34 | 35 | 36 |
| 37 | 38 | 39 | 40 |
| 41 | 42 | 43 | 44 |
| 45 | 46 | 47 | 48 |
| 49 | 50 | 51 | 52 |
| 53 | 54 | 55 | 56 |
| 57 | 58 | 59 | 60 |
| 61 | 62 | 63 | 64 |
| 65 | 66 | 67 | 68 |
| 69 | 70 | 71 | 72 |
| 73 | 74 | 75 | 76 |
| 77 | 78 | 79 | 80 |
| 81 | 82 | 83 | 84 |
| 85 | 86 | 87 | 88 |
| 89 | 90 | 91 | 92 |
| 93 | 94 | 95 | 96 |
| 97 | 98 | 99 | 100 |

INSTALLATION,
TURN SIGNAL
(TRUCK 24 VOLTS)

ORDNANCE CORP.
DEPT. OF THE ARMY
DETROIT ARMO.
7019172